

Work Order ID 134125

Thursday, July 02, 2015 1:56:31 PM

134125

Page 1

Item ID: D412-664-403

Revision ID: U/R (URF 15-561)

Item Name: 412 Stainless Steel Aft Crosstubes - High

Accept

N900040100Setup Start ***NS1***Stop ***NS2***Start Date: 7/2/2015 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 7/2/2015 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: ML5 Date: JUL 02 2015

Tooling:

Date:

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D412-664-443

A U/R

OK

CP 15/7/6

100

Document Control

0.00

100

DOCUMENT CONTROL

DC

Memo

0.00

Doc.Control -USB or Paperwork

Photocopy bluefile & type labels per PPPD412-664-403 CHG001

DAS
02
9-89AUG 24 2015
AUG 24 2015

110

110

CNC Bend 2

BENDING MACHINE - CROSSTUBES

0.00

Memo

0.00

CNC Alpha 160 Bender

Bend tube as per Dwg D412-664-443 using CNC bender program _____ and Folio FT _____

****USE (4) DT9824 SHIM BLOC TO CHECK STRAIGHTNESS****

NTW 15-08-13

127

127

QC

QC15- Crosstube Dimensional Check

0.00

Memo

- 0.00

Quality Control

MARK CUT LINES

DAS
38
9-89

15-08-13

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Work Order ID 134125

Thursday, July 02, 2015 1:56:31 PM

134125

Page 2

Item ID: D412-664-403

Accept

N900040100

Setup Start *NS1*

Revision ID: U/R (URF 15-561)

Item Name: 412 Stainless Steel Aft Crosstubes - High

Stop *NS2*

Start Date: 7/2/2015 Start Qty: 1.00 *1*

Cust Item ID:

Required Date: 7/2/2015 Req'd Qty: 1.00 *1*

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

128

128

Crosstubes

Crosstubes

Memo

CUT TUBE AT HEIGHT ON FAI SHEET

VERF HEIGHT 24.62 BY QC 15 LEVEL INSPECTOR TL

VERF TWIST 0.159 BY QC15 LEVEL INSPECTOR TL

0.00

0.00

BL 15/08/12

130

130

Crosstubes

Crosstubes

Crosstubes

Memo

1- Drill Tube as per Dwg D412-664-443 Using DT 8550/8551 Drill Jigs,
Set-up drill table as per QSI 010

2 -Deburr

3- Engrave Part # and Batch # as per Dwg D412-664-443

4-Remove all marks from tube within limits of D412-664-43 DWG. — BL 15/08/17

0.00

0.00

BL TL 15/08/14

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval																	
Root Cause		FAULT CATEGORY																							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐		Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐		Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐																	
		OTHER : ☐																							

Work Order ID 134125***134125***

Page 3

Thursday, July 02, 2015 1:56:31 PM

Item ID: D412-664-403 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: U/R (URF 15-561) Stop ***NS2***
Item Name: 412 Stainless Steel Aft Crosstubes - High
Start Date: 7/2/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 7/2/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140 *140* QC Quality Control	QC6- Inspect dimensions to drawing <i>Qc5</i>	0.00				1			DAS 38 9-89 AUG 17 2015
174 *174* Outsource2 Outsource process - NDT	Outsource process - NDT per QSI038 4.1 Memo ISSUE P/O TO ACCUREN: <u>29493</u>	0.00							<i>COX</i> AUG 18 2015 1
176 *176* Packaging Packaging	Receive & Inspect for Damage & Mat'l Certs Memo	0.00							<i>IX SP 15-08-18</i>

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Thursday, July 02, 2015 1:56:31 PM

Item ID: D412-664-403

Accept

N900040100

Setup Start *NS1*

Revision ID: U/R (URF 15-561)

Item Name: 412 Stainless Steel Aft Crosstubes - High

Stop *NS2*

Start Date: 7/2/2015 **Start Qty:** 1.00 ***1***

Cust Item ID:

Required Date: 7/2/2015 **Req'd Qty:** 1.00 ***1***

Customer:

Reference:

Approvals: **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____

Run Start *NR1*

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop *NR2*

Sequence ID/
Work Center ID

Operation Description

Set Up/ Run Hours

Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
---------	--------	-----------	------------	------------	---------------	-------------

178

QC5- Inspect part completeness to step on W/O	0.00
---	------

0.00

178

OC

Memo

0.00

Quality Control

DA
38
9-89

15-08-A

180

0.00

180

SprayPaint

SprayPaint

Memo

0.00

Spray Painting

1-Prime inside & outside crosstube as per QSI 005 4.2

BATCH: 132384

2- MASK UNDERSIDE OF CROSSTUBE AS SHONE ON DWG BEFORE PAINTING

3 -Paint Outside of Tube as per Dart QSI 005 4.2

BATCH: 132664

4- After painting remove masking and apply matte clear coat per OSI005 4.2

CLEAR BATCH: 131483

DAS
41
9-20

15-8-20

DQA:

Date: 15/09/02



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed:

Date: 15/09/01

Work Order update only

Work Order: 134125		DISPOSITION		AGAINST DEPARTMENT/PROCESS					
Part No. 2412-664-403		Rework ☒		Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☒		
NCR No. 15-5293		Scrap ☐		Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐		
		Use-as-is ☐		Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐		
		Suspected Unapproved ☐		Large Fab ☐	Composite ☐	Supplier ☐			
Date: 15/7/6		Step #: 180		QTY Effective: 1			MRB (QSI042) Approval DAS 12 15/7/6		
Description Work Order Deviation				Disposition					
Use Axalta cleaner & metaluk per manufacturer's instruction. Axalta greatly increases paint adhesion, based on internal tests.				Axalta 132055 BIN: 132520 Axalta 2305 BIN: 132474				Completed By DAS 4? 15-8-19 9-89	
								Lead hand / Supervisor Approval Verification DAS 9 15-08-24 9-89	
								QC / QA Coordinator Approval DAS 9 15-08-24 9-89	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☒	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☒	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER :							

Work Order ID 134125***134125***

Page 5

Thursday, July 02, 2015 1:56:31 PM

Item ID: D412-664-403

Accept

N900040100

Setup Start

NS1

Revision ID: U/R (URF 15-561)

Stop

NS2

Item Name: 412 Stainless Steel Aft Crosstubes - High

Start Date: 7/2/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 7/2/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan: _____

Date: _____

Tooling: _____

Date: _____

Run Start

NR1

QC: _____

Date: _____

SPC (Y/N): _____

Date: _____

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

190

QC14- Inspect Spray Paint

0.00

190

QC

Memo

0.00

Quality Control

DAS

38

9-89

AUG 24 2015

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Work Order ID 134125

Thursday, July 02, 2015 1:56:31 PM

134125

Page 6

Item ID: D412-664-403

Accept

N900040100

Setup Start

NS1

Revision ID: U/R (URF 15-561)

Stop

NS2

Item Name: 412 Stainless Steel Aft Crosstubes - High

Start Date: 7/2/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 7/2/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

NR1

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
200		0.00							DAS
200	Crosstubes					1			41
Crosstubes									9-83

Memo

0.00

1- Install center support using scoth-weld DP460 per QSI 015, as per DWG. note 12. Install supports clamps using as per Dwg D412-644-443. Install clamp with rubber cushion as per DWG. note 13. ***ENSURE CLAMPS ARE ON TOP OF CROSSTUBE SUPPORT*** Torque clamps on support to 80-100 IN-LBS AS PER DWG.

A/R scoth-weld DP460

BATCH #: 132895
EXP DATE: 8/16

2- **IF NOT ALREADY PRESENT ON CHAFFING SHEILD.** Apply a thin coat of proseal 890 per QSI 015 on inside concave surface of chafing shield and let cure per manufacturer's instructions. Install prosealed chafing shield onto crosstube by applying a thin coat of proseal 890 onto crosstube. Be sure to eliminate any air gaps. Install and torque clamps on chafing shield to 40-50 IN-LBS AS PER DWG.

A/R Proseal 890

Batch: 132655
EXP DATE: 3/16

AFTER FINISH CURE TIME 24H

START CURE TIME: 15-8-21FINISH CURE TIME: 15-8-22

PRIOR TO PACKAGING RE-CHECK TORQUE ON CLAMPS AFTER CURED FOR 24H.

15-8-21

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

Work Order ID 134125

Thursday, July 02, 2015 1:56:31 PM

134125

Page 7

Item ID: D412-664-403 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: U/R (URF 15-561) Stop ***NS2***
Item Name: 412 Stainless Steel Aft Crosstubes - High
Start Date: 7/2/2015 Start Qty: 1.00 ***1*** Cust Item ID:
Required Date: 7/2/2015 Req'd Qty: 1.00 ***1*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
210 *210* QC Quality Control	QC5- Inspect part completeness to step on W/O Memo PRIOR TO PACKAGING RE-CHECK TORQUE ON CLAMPS AFTER CURED FOR 24H.	0.00 0.00				1			DAS 38 9-89 AUG 24 2015
220 *220* Packaging Packaging	Pick Kit Memo	0.00 0.00							DAS 6 9-89 AUG 24 2015
230 *230* QC Quality Control	QC4- 100% Inspect kits for completeness Memo	0.00 0.00							DAS 02 9-89 AUG 24 2015

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER : _____							

Work Order ID 134125

Thursday, July 02, 2015 1:56:31 PM

134125

Page 8

Item ID: D412-664-403

Accept

N900040100

Setup Start

NS1

Revision ID: U/R (URF 15-561)

Item Name: 412 Stainless Steel Aft Crosstubes - High

Stop

NS2

Start Date: 7/2/2015 Start Qty: 1.00

1

Cust Item ID:

Required Date: 7/2/2015 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

NR1

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
240		0.00							
240	Packaging								DAS
Packaging	Memo	0.00							02
Packaging	Identify and pack for shipping as per PPPD412-664-443								9-89
	Location: _____								AUG 24 2015
	PPP Rev: _____								
250	QC21- Final Inspection - Work Order Release	0.00							
250									
QC	Memo	0.00							MLC
Quality Control									AUG 24 2015

SIL 20150824

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
☐ OTHER : _____					

Picklist Print

Thursday, July 02, 2015 1:56:34 PM

Page 1

Work Order ID: 134125

134125

Parent Item: D412-664-403

D412-664-403

Parent Item Name: 412 Stainless Steel Aft Crosstubes - High

Start Date: 7/2/2015

Required Date: 7/2/2015

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP REV:A 13.10.25 NEW ISSUE DD VERF:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D412-664-443TRN		Manufactured	No			110	Each	0.0000	1	1			
D412-664-443TRN									**				
Crosstube Turning Detail													
D3595-063-530		Manufactured	No			200	Each	128.0000	2	2			
D3595-063-530									**				
Rubber Cushion 0.63" wide x 5.30" Long													

Location	Loc Qty	Loc Code
FG	1	
82656	1	
LG051	127	
115704	52	
132515	75	

D4909-1		Manufactured	No			200	Each	8.0000	1	1			
D4909-1									**				
Support													

Location	Loc Qty	Loc Code
LG053	8	
121062	2	
130094	6	

D4910-1		Manufactured	No			200	Each	8.0000	2	2			
D4910-1									**				
Chaffing Shield													

Location	Loc Qty	Loc Code
LG053	8	
130093	8	

JW 15-08-13

DAS 41 9-89 15-8-21

DAS 41 9-89 15-8-21

DAS 41 9-89 15-8-21

2

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																	
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																	
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																	
Large Fab ☐	Composite ☐	Supplier ☐																																																																		
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval																																																																
Description Work Order Deviation		Disposition		Completed By																																																																
				Lead hand / Supervisor Approval Verification																																																																
				QC / QA Coordinator Approval																																																																
Root Cause <table style="width:100%; border: none;"> <tr><td style="border: none;">Environment ☐</td><td style="border: none;">No Re-verification ☐</td></tr> <tr><td style="border: none;">Design ☐</td><td style="border: none;">Operator ☐</td></tr> <tr><td style="border: none;">Doc/Data ☐</td><td style="border: none;">Offset/Setup ☐</td></tr> <tr><td style="border: none;">Equip/Tooling ☐</td><td style="border: none;">Supplier ☐</td></tr> <tr><td style="border: none;">Handling/Pre ☐</td><td style="border: none;">Training ☐</td></tr> <tr><td style="border: none;">Material ☐</td><td style="border: none;">Use for Testing ☐</td></tr> <tr><td style="border: none;">Internal Transport ☐</td><td style="border: none;">Poor Information ☐</td></tr> <tr><td style="border: none;">Tribal Knowledge ☐</td><td style="border: none;">Rushing ☐</td></tr> <tr><td style="border: none;">LOA ☐</td><td style="border: none;">Product Improvement ☐</td></tr> <tr><td style="border: none;">Substation ☐</td><td style="border: none;">Process Improvement ☐</td></tr> <tr><td style="border: none;">Past Expiry Date ☐</td><td style="border: none;">Manufacturing Process ☐</td></tr> <tr><td style="border: none;">Misidentified ☐</td><td style="border: none;">Past Due ☐</td></tr> </table>		Environment ☐	No Re-verification ☐	Design ☐	Operator ☐	Doc/Data ☐	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	FAULT CATEGORY <table style="width:100%; border: none;"> <tr><td style="border: none;">☐ Pressure/Forced</td><td style="border: none;">☐ Temperature/Cure</td><td style="border: none;">☐ Power Loss/Surge</td><td style="border: none;">☐ Positioned Wrong</td></tr> <tr><td style="border: none;">☐ Bending</td><td style="border: none;">☐ Set-up</td><td style="border: none;">☐ Folio/Program</td><td style="border: none;">☐ Outside Dimensions</td></tr> <tr><td style="border: none;">☐ Centre Not Concentric</td><td style="border: none;">☐ BOM/Route</td><td style="border: none;">☐ Grain</td><td style="border: none;">☐ Over/Under tolerance</td></tr> <tr><td style="border: none;">☐ Cracks</td><td style="border: none;">☐ Broken/Damage/Defect</td><td style="border: none;">☐ Weld</td><td style="border: none;">☐ Part Incorrect</td></tr> <tr><td style="border: none;">☐ Crimp/Kink/Ripple/Wave</td><td style="border: none;">☐ Inspection Incomplete/Unqualified</td><td style="border: none;">☐ Wrong Stock Pulled</td><td style="border: none;">☐ Part Lost/Missing</td></tr> <tr><td style="border: none;">☐ Cuffs</td><td style="border: none;">☐ Contamination</td><td style="border: none;">☐ Out of Sequence</td><td style="border: none;">☐ Part Moved</td></tr> <tr><td style="border: none;">☐ Crushing</td><td style="border: none;">☐ Countersink</td><td style="border: none;">☐ Off-set</td><td style="border: none;">☐ Drawing</td></tr> <tr><td style="border: none;">☐ Heat Treat</td><td style="border: none;">☐ Cut Too Short</td><td style="border: none;">☐ Mislabeled</td><td style="border: none;">☐ Finish</td></tr> <tr><td style="border: none;">☐ Wave/Twist in Tube</td><td style="border: none;">☐ Instructions Incomplete/Unclear</td><td style="border: none;">☐ Fit/Function</td><td style="border: none;">☐ Misread</td></tr> <tr><td style="border: none;">☐ Marks/Chatter</td><td style="border: none;">☐ Drill Holes</td><td style="border: none;">☐ Misaligned/off center</td><td style="border: none;">☐ Turning Sequence</td></tr> </table>			☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence
Environment ☐	No Re-verification ☐																																																																			
Design ☐	Operator ☐																																																																			
Doc/Data ☐	Offset/Setup ☐																																																																			
Equip/Tooling ☐	Supplier ☐																																																																			
Handling/Pre ☐	Training ☐																																																																			
Material ☐	Use for Testing ☐																																																																			
Internal Transport ☐	Poor Information ☐																																																																			
Tribal Knowledge ☐	Rushing ☐																																																																			
LOA ☐	Product Improvement ☐																																																																			
Substation ☐	Process Improvement ☐																																																																			
Past Expiry Date ☐	Manufacturing Process ☐																																																																			
Misidentified ☐	Past Due ☐																																																																			
☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong																																																																	
☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions																																																																	
☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance																																																																	
☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect																																																																	
☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing																																																																	
☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved																																																																	
☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing																																																																	
☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish																																																																	
☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread																																																																	
☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence																																																																	
OTHER : _____																																																																				

Picklist Print

Thursday, July 02, 2015 1:56:34 PM

Page 2

Work Order ID: 134125

134125

Parent Item: D412-664-403

D412-664-403

Parent Item Name: 412 Stainless Steel Aft Crosstubes - High

Start Date: 7/2/2015

Required Date: 7/2/2015

Start Qty: 1.00

Required Qty: 1.00

MS21920-26

Purchased

No

200

Each

40.0000

4

4

MS21920-26

Clamp

DAS

41

9-89

15-8-21

Location

Loc Qty

Loc Code

LG050

40

109206

10

M132045

30

4

MS21920-28

Purchased

No

200

Each

183.0000

2

2

MS21920-28

Clamp

DAS

41

9-89

15-8-21

Location

Loc Qty

Loc Code

FG

1

105884

1

LG050

78

131651

26

M130400

50

M130665

2

LG051

104

M132169

38

M132381

28

M132522

38

2

AN6-40A

Purchased

No

220

Each

146.0000

4

4

AN6-40A

3/8-24 BOLT X 3"LONG

DAS

6

9-89

AUG 24 2015

Location

Loc Qty

Loc Code

ST286A

144

M131618

44

M131803

100

ST333

2

M130466

2

4

DAS

02

9-89

Thursday, July 02, 2015 1:56:35 PM

Shop Packet Print

Page 2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
							Completed By 		
							Lead hand / Supervisor Approval Verification 		
							QC / QA Coordinator Approval 		

Root Cause				FAULT CATEGORY			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐		
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐		
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐		
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐		
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐		
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐		
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐		
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐		
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐		
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐		
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____					
Misidentified ☐	Past Due ☐						

Picklist Print

Thursday, July 02, 2015 1:56:35 PM

Page 3

Work Order ID: 134125

134125

Parent Item: D412-664-403

D412-664-403

Parent Item Name: 412 Stainless Steel Aft Crosstubes - High

Start Date: 7/2/2015

Required Date: 7/2/2015

Start Qty: 1.00

Required Qty: 1.00

AN6-41A Purchased No 220 Each 85.0000 2 2

AN6-41A

Bolt

DAS
6
9-89

DAS
02
9-89

Location

Loc Qty

Loc Code

ST286A

63

M129913

3

M131957

60

ST333

22

M129934

2

M131618

20

AN960JD616 NAS1149D0663J Purchased No

220 Each 0.0000 18 18

AN960JD616

Washer

M132256

DAS
6
9-89

MS21042L6 Purchased No

220 Each 417.0000 6 6

MS21042L6

Nut

DAS
6
9-89

DAS
02
9-89

Location

Loc Qty

Loc Code

ST260a

199

m132262

199

ST273A

200

m131624

200

ST305

1

m129909

1

t260a

17

m131317

17

AUG 24 2015

Thursday, July 02, 2015 1:56:35 PM

Shop Packet Print

Page 3

DQA:

Date: 15/09/02



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed


Date: 15/09/01

Work Order update only

Work Order: 134125		DISPOSITION		AGAINST DEPARTMENT/PROCESS					
Part No. D412-664-403		Rework ☐		Skid-tube ☐	Cross tube ☒	Water Jet ☐	Engineering ☐		
NCR No. 15-5291		Scrap ☐		Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐		
		Use-as-is ☒		Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐		
		Suspected Unapproved ☐		Large Fab ☐	Composite ☐	Supplier ☐			
Date: 15.08.13		Step #: 110		QTY Effective: ①			MRB (QSI042) Approval A.P. 15.08.13		
Description Work Order Deviation				Disposition			Completed By A.P. 15.08.13		
SEE XTUBE BEND DIM SHEET 1/2 SPAN BELOW MIN BY 0.060" & 0.090". OVERALL SPAN UNDER MIN BY 0.150". P.C. Material.				ACCEPTABLE TO USE AS-IS. MAXIMUM DEVIATION BETWEEN FWD & AFT XTUBE IS $\Delta=0.67$ " "CROSSTUBE STIFFNESS WILL BE MAINTAINED TEMPORARILY AFFECTED UNTIL DETERMINED THROUGH USE. NEGLIGIBLE EFFECT ON FIT OR FUNCTION, STRENGTH OR FATIGUE.			Lead hand / Supervisor Approval Verification JW 15-08-13		
							QC / QA Coordinator Approval DAS 9 9-89 15-08-13		
Root Cause				FAULT CATEGORY					
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☒	BOM/Route ☐	Grain ☐	Over/Under tolerance ☒				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☒	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐								
Misidentified ☐	Past Due ☐	OTHER :							

DART AEROSPACE LTD		Work Order:	134125
Description: Crosstube High Aft (412)		Part Number:	D412-664-403
Inspection Dwg: D412-664-443 Rev: A		Page 1 of 1	

Required Dimension	Min	Max
Height	24.12	24.62
1/2 Span	53.56	53.82
Angle	49°	52°
Total Span	107.12	107.64
Bending Passes	8	--
Crushing	--	7%

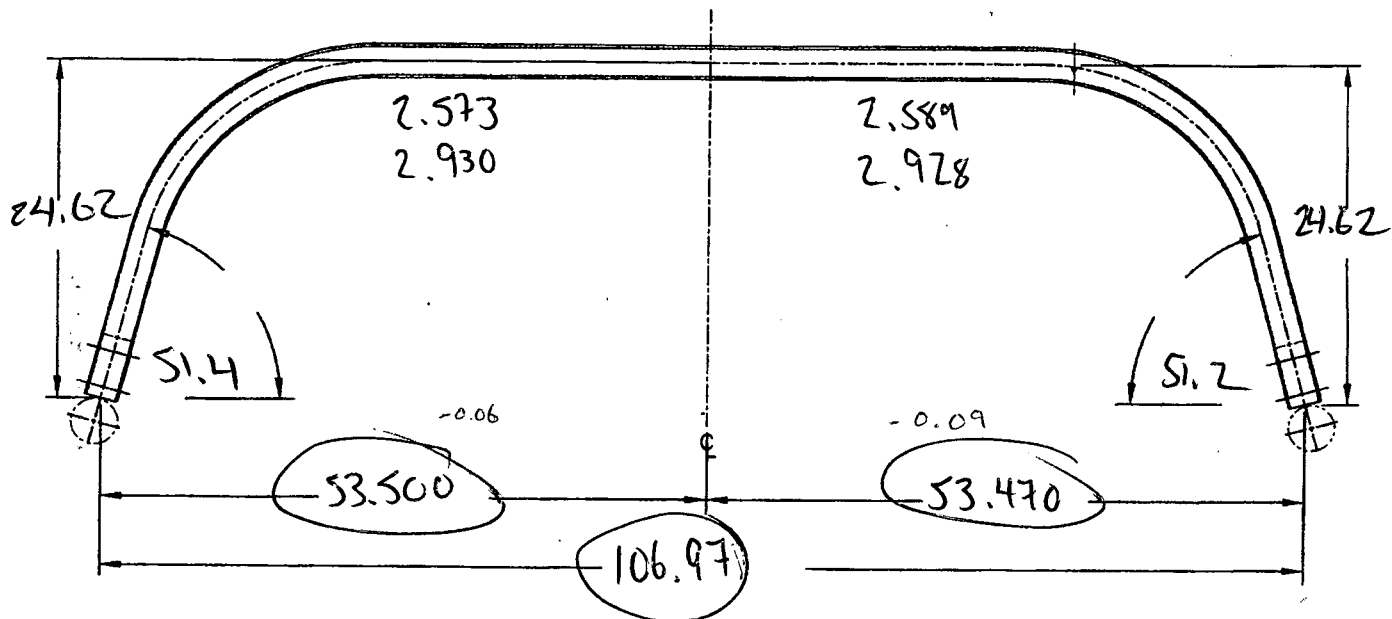

	Side A	Side B
Bending Passes	5	4
Crushing	6.5%	6.1%
Comments		

QC15 Inspection	38
Date	15-08-13

Rev	Date	Change	Revised by	Approved
A	14.07.08	New Issue	KJ	CP

Item	Qty -443	Part Number	Description
1	X	D412-664-443	CROSSTUBE ASSEMBLY (412 HI AFT)
2	1	D6020-132	CROSSTUBE MATERIAL (132" MIN. LENGTH)
3	2	D3595-063-530	RUBBER CUSHION
4	1	D4909-1	SUPPORT
5	2	D4910-1	CHAFING SHIELD
7	4	MS21920-26	CLAMP
8	2	MS21920-28	CLAMP
9	A/R	SCOTCH-WELD DP460	EPOXY ADHESIVE, 3M SCOTCH-WELD
10	A/R	PROSEAL 890	SEALANT

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6020-132
FINISHED LENGTH = 130.10±0.060 (BEFORE BENDING/TRIMMING)
 - FINISH: PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2, HATCHED AREA)
PAINT OUTSIDE PER DART QSI 005 4.2
AFTER PAINTING, REMOVE MASKING AND APPLY MATTE CLEAR COAT PER DART QSI 005 4.2
 - TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
 - UNITS: INCHES UNLESS OTHERWISE NOTED.
 - BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
 - IDENTIFICATION: SCRIBE DART P/N "D412-664-443" AND B/N ON INSIDE OF CUFF PER DART QSI 044 6.4 (VIBRATING STYLUS)
 - WEIGHT: 90.2 lb AFTER MACHINING
86.7 lb FINISHED WEIGHT
 - PART IS SYMMETRIC ABOUT CENTERLINE.
 - EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- BENDING**
- BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 7% (BASED ON O.D.) IN LOWER HALF OF R35 BEND AND 6% (BASED ON O.D.) ON REMAINING TUBE.
 - LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038. TO BE PERFORMED AFTER FINAL POST-BEND GRINDING. ANY ADDITIONAL GRINDING REQUIRES ANOTHER LPI INSPECTION.
- ASSEMBLY**
- INSTALL D4909-1 CENTER SUPPORT USING A 0.04" TO 0.07" THICK LAYER OF SCOTCH-WELD DP460 PER QSI 015.
 - INSTALL MS21920-28 CLAMPS WITH D3595-063-530 RUBBER CUSHIONS TO SECURE THE D4909-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE ON TOP OF CROSSTUBE SUPPORT.
 - IF NOT ALREADY PRESENT ON CHAFING SHIELD, APPLY A THIN COAT OF PROSEAL 890 ON INSIDE CONCAVE SURFACE OF D4910-1 CHAFING SHIELD AND LET CURE PER MANUFACTURER'S INSTRUCTIONS. INSTALL PROSEAL D4910-1 CHAFING SHIELD ONTO CROSSTUBE BY APPLYING A THIN COAT OF PROSEAL 890 ONTO CROSSTUBE. BE SURE TO ELIMINATE ANY AIR GAPS.
 - TORQUE CLAMPS ON D4909-1 SUPPORT 80 TO 100 IN-LB. TORQUE CLAMPS ON D4910-1 CHAFING SHIELD 40 TO 50 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER ADHESIVES HAVE CURED FOR 24 HOURS.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER

NO. 134.125 MJS

1507-02

UNDER REVIEW

4/15/14
LRF 15-561


UNDER REVIEW

4/17/14
NKM/URG 11-651


RELEASED
2014-05-26

A	NEW ISSUE	CP	14.04.01
REV.	DESCRIPTION	BY	DATE
DESIGN			
DRAWN			
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	14.04.01		


DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWING NO. D412-664-443	REV. A SHEET 1 OF 4
TITLE CROSSTUBE ASSY (412 HI AFT)	SCALE NTS
COPYRIGHT © 2013 BY DART AEROSPACE LTD THIS DOCUMENT IS PRESENTED FOR INFORMATION AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

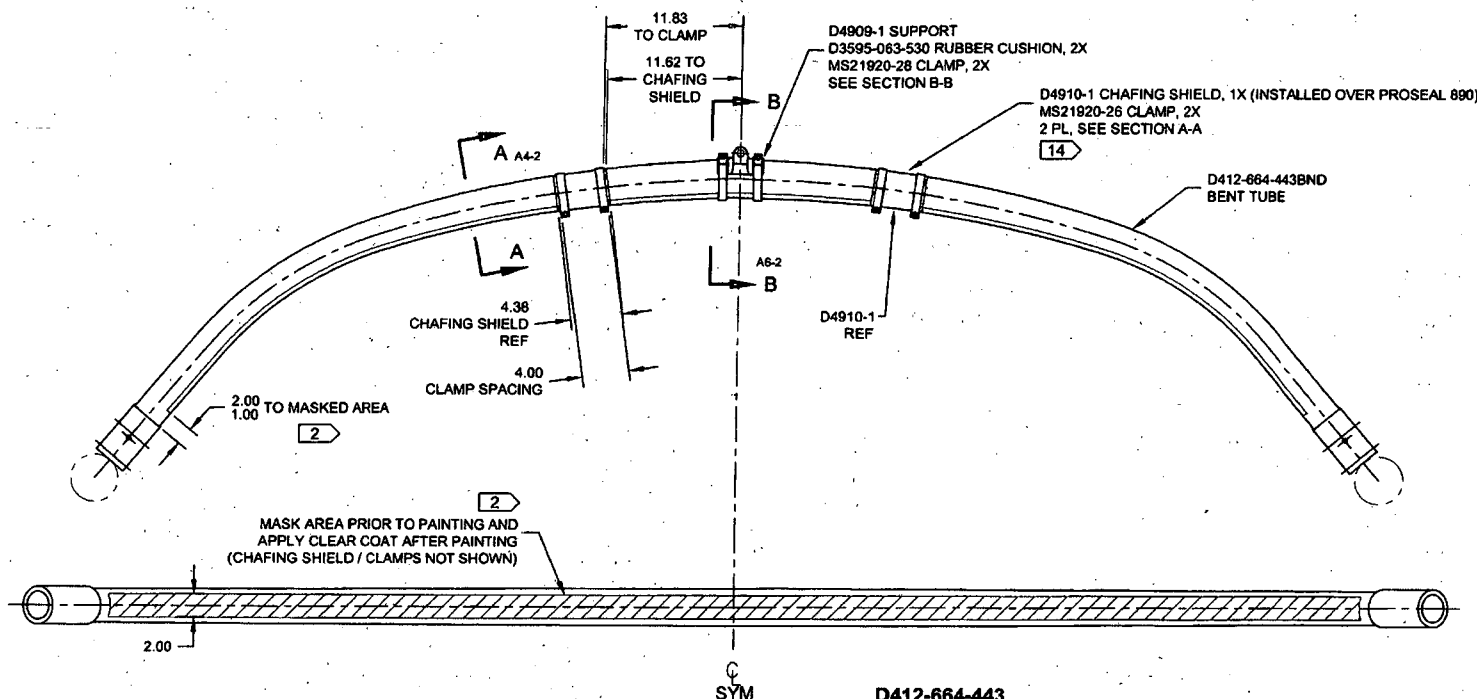

D412-664-443
ASSEMBLY DETAIL

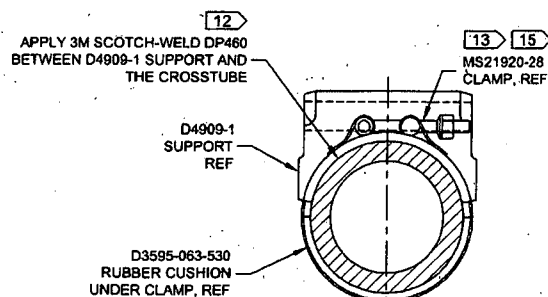

SECTION B-B D4-2
SCALE 4X

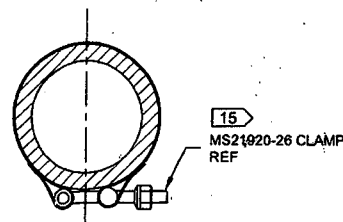


SECTION A-A C6-2
SCALE 4X

UNDER REVIEW
9/14/14 11/16/14


RELEASED
2014-05-26
WMD

UNDER REVIEW
15/14/20

DESIGN	90	DART AEROSPACE LTD	
DRAWN	90	HAWKESBURY, ONTARIO, CANADA	
CHECKED	90	DRAWING NO.	REV. A
MFG. APPR.	90	D412-664-443	SHEET 2 OF 4
APPROVED	90	TITLE	SCALE
DE APPR.	90	CROSSTUBE ASSY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2013 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR REPRODUCED OR CONVEYED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

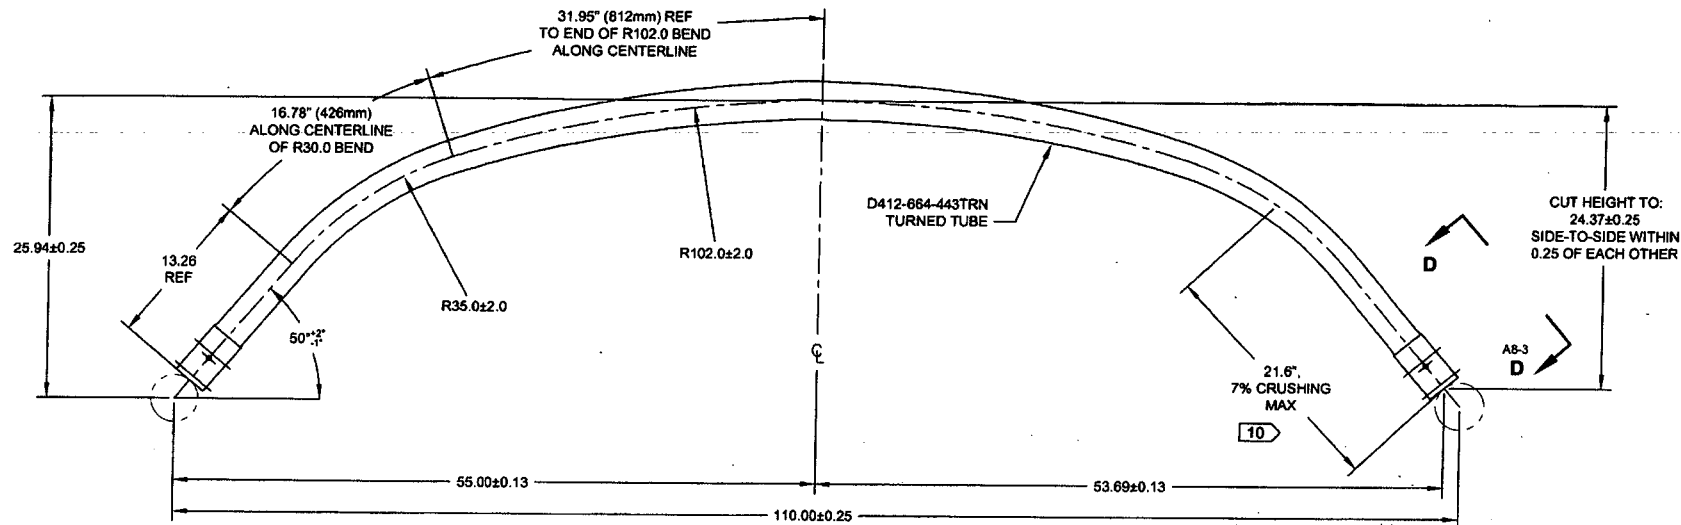

D412-664-443BND
BENDING DETAIL

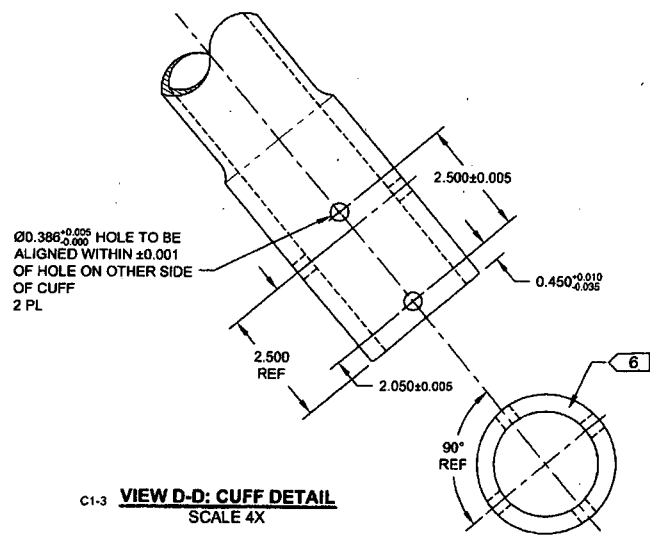

VIEW D-D: CUFF DETAIL
SCALE 4X


OK
P. 1/14

UNDER REVIEW
11/17/14

RELEASED
2014-05-26

UNDER REVIEW
P. 15/14/24


DESIGN	DP	DART AEROSPACE LTD	
DRAWN	DP	HAWKESBURY, ONTARIO, CANADA	
CHECKED	DW	DRAWING NO.	REV. A
MFG. APPR.	AS	D412-664-443	SHEET 3 OF 4
APPROVED	AS	TITLE	SCALE
DE APPR.	AS	CROSSTUBE ASSY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2013 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMING OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

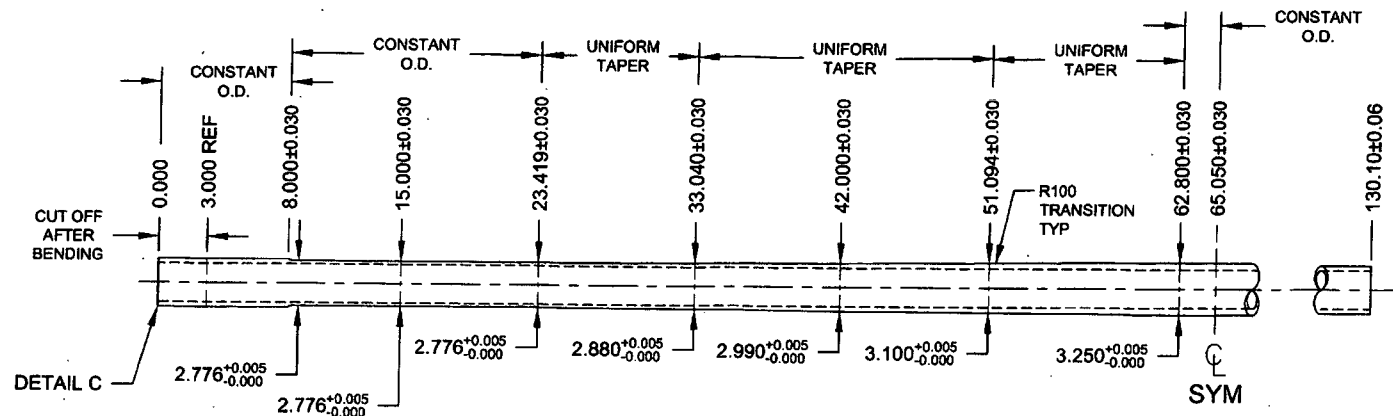


D412-664-443TRN
TURNING DETAIL

UNDER REVIEW

15/14/28

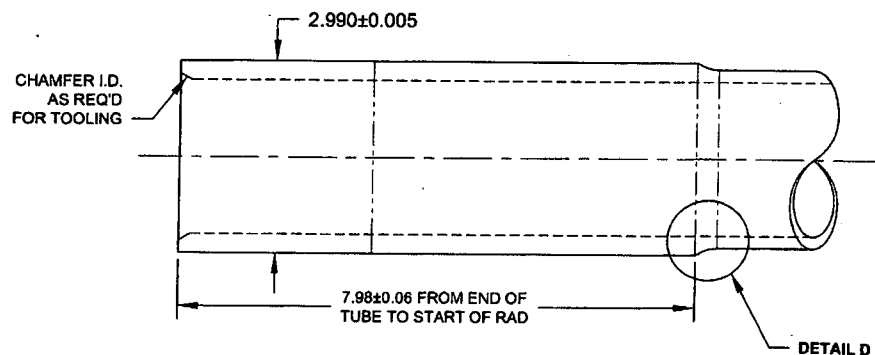

DETAIL C:
CUFF TRANSITION
SCALE 4X

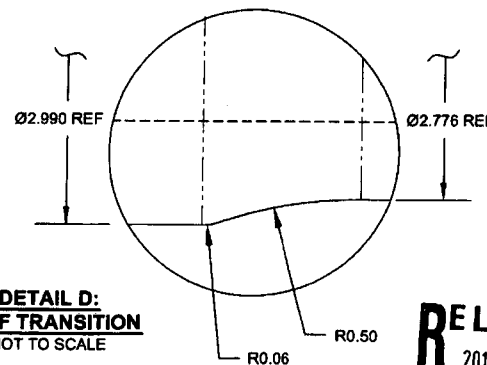

DETAIL D:
CUFF TRANSITION
NOT TO SCALE

RELEASED
2014-05-26

DESIGN	99	DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED	99	DRAWING NO.	REV. A
MFG. APPR.		D412-664-443	SHEET 4 OF 4
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASSEMBLY (412 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2013 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

D412-664-403 Stainless Steel Hardened Crosstube

setup

3.25" rollers

Bend lines are @ 32", 35" from centerline of tube

1.75" shims are used in the buggy for side bends

Middle Bend

Middle bend goes from 35" line with crosstube being on the large table of the machine.

Approach for middle bend is 2870 on both rollers. Run programs middle auto, middle 6 check.

Side Bends

Run programs side 1-10 down the taper from 32" tangent line. Approach is 2900 on Y roller and 3385 on W roller. Programs 1-5 go back to the tangent line ready for next bend. Program 6-10 release at the end. Approaches on programs 6-10 are on the first line of programs... Programs 11-15 run down taper for 9" then come back up to finish tube slowly, be careful with these programs...

Enjoy

Notes:

13/12/12 ran 1 tube, program middle 6 was not enough, prog middle 7 overbent slightly. will create middle 6b to be a halfway point. after program 7 we ran the tube as per folio. one side finished nicely at program 10, the opposite side finished nicely after running program 1 2 times, then 13 to finish. this left the tube closer to max tolerance on the span, 53.730/53.800.

15/06/03 middle auto has been made but, due to the long program, only contains programs 1-5. program 6 must be run separately prior to checking tube on wall.

2	MAYO	2
4	6	4
6	7	6
8		8
—		—

364
5.502 205.9 6.60%
359
5.515 6.5

DART
AEROSPACE

Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
Tel: 613 632 9577
Fax: 613 632 1053

PURCHASE ORDER

Purchase Order ID **PO29493**

Purchase Order Date 8/18/2015

PO Print Date 8/18/2015

Page Number 2 of 3

Order From :

VC-SKY001

Ship To : DART AEROSPACE LTD

SKYSERVICE
6120 MIDFIELD ROAD
MISSISSAUGA, ONTARIO L5P 1B1
CANADA

1270 ABERDEEN
HAWKESBURY, ON K6A 1K7
CANADA

Contact Name

Vendor Phone 905-678-5636

Buyer

Chantal Lavoie

Customer POID

Customer Tax #

10127-2607

Terms

Net 30

Currency

CAD

FOB

FCA - (Free Carrier)

Ship To Contact

Ship To Phone

Ship Via:

Delivered

Ship Acct:

Line Total: \$175.00

3	131079	D412-664-206 CROSSTUBE	8/18/2015	1.00	\$175.00	\$175.00
---	--------	---------------------------	-----------	------	----------	----------

Yes
8/18/2015

LIQUID PENETRANT INSPECTION AS PER QSI 038 OR
LPI AS PER ASTM 1417 LEVEL 2

Line Total: \$175.00

4	134125	D412-664-403 CROSSTUBE	8/18/2015	1.00	\$175.00	\$175.00
---	--------	---------------------------	-----------	------	----------	----------

Yes
8/18/2015

LIQUID PENETRANT INSPECTION AS PER QSI 038 OR
LPI AS PER ASTM 1417 LEVEL 2

Line Total: \$175.00

5	134126	D412-664-403 CROSSTUBE	8/18/2015	1.00	\$175.00	\$175.00
---	--------	---------------------------	-----------	------	----------	----------

Yes
8/18/2015

LIQUID PENETRANT INSPECTION AS PER QSI 038 OR
LPI AS PER ASTM 1417 LEVEL 2

Note:

8/18/2015

132991

skyservice Work Order Traveler

Sky Service F.B.O. Inc.

DOT APP 63-89 / EASA 145.7142 / BDA AMO 385

WO #: MWO25513	Customer: Dart Aerospace Ltd.	Dept: NDT YUL	Reference: 29493
Descr:	PN:	S/N:	Qty: 1
Make:	Model:	Reg:	A/C S/N:
TSN:	CSN:	TSO:	
Task: UNSCHEDULED			Sequence: 1

Work Required:

CARRY OUT NDT ON 4 CROSSTUBES AS PER PO29493


2 STAINLESS STEEL AFT CROSSTUBES, ITEM ID# D412-664-403, WORK ORDER ID# 134125, 134126

2 AFT CROSSTUBES, ITEM ID# D412-664-209, WORK ORDER ID# 130356, 131079

Action Taken:						Date:	Initial/Stamp:
LPI C/O IAW ASTM E-1417M-13 ***NO CRACK FOUND*** PEN. ZL-56, MPO13600, UV M-20141, CLEANER SKC-S MPO13923 , DEV. MPO11715						AUG 18 2015	
Description	Location	P/N	Qty	Batch	S/N Off	S/N On	

SP15-08-18

I certified that the maintenance described above has been performed in accordance with the applicable standard of airworthiness.

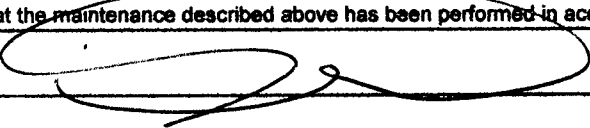Signature: 	ACA/SCA Stamp 	Date: AUG 18 2015
Name: RAFIK MELIKIAN		